

RotorWay International  
December 21, 2010

**To all Talon aircraft kits shipped from 10/14/08 – 7/8/10 and  
Exec owners with Electric Clutch Conversions in the same time frame.  
Advisory Bulletin A-47**

History: Electric clutch actuator mount (E27-8630) may bind between the mount and the clutch actuator. This binding action is due to a lack of clearance between the mount and the clutch actuator (E27-8500) see diagram 1.

Action: Check for binding when engaging/disengaging clutch. If binding does occur, remove actuator mount and remove material from the mount as shown in diagram 2. Up to 10 degrees of material can be removed from the actuator mount.

Diagram 1



Diagram 2

